

CONSUMER PRODUCTS SERVICES DIVISION VERITAS

Plicosa International Taiwan Ltd

Technical Report:	
Date Received:	
Mod. Date:	

(6619)305-0589 NOV.01, 2019 / NOV.14, 2019 Page 1 of 10

Andy/Tracy/Isaac Plicosa International Taiwan Ltd 3F,No.39,Lane513,RuiguangRd.,Neihu,Taipei,Taiwan

Sample Description:	STEEL TEXILENE LOUNGE	R	
Manufacturer:	ZHEJIANG LINYA	PO No.:	/
	CO.,LTD.		
Buyer:	/	Style No	TGLST0059(LLCT9299)
Country of Origin:	CHINA	Country of Destination:	/
Color:	/	SKU No.:	/
Protocol No.:	/	Previous Report No.:	/

TEST INFORMATION & EXECUTIVE SUMMARY

Evaluation To:	 For compliance with: - EN 581-1: 2017, Outdoor furniture – seating and tables for camping, domestic and contract use – Part 1: general safety requirement. EN 581-2: 2015 + AC: 2016 – Outdoor furniture – Seating and tables for camping, domestic and contract use – Part 2: mechanical safety requirements and test methods for seating. (Test level: domestic level)
Standards Employed:	As specified in above standard(s)
	 EN 1022: 2005, Domestic furniture – seating – determination of stability
	2. EN 1728: 2012+AC:2013, Domestic furniture – seating – test methods for the
	determination of strength and durability
Conclusions:	1. The tested sample COMPLIED with the above standard: EN 581-1: 2017
	 The tested sample COMPLIED with the above standard: EN 581-2: 2015 + AC: 2016 (Test level: domestic level)

REMARK:

The client specifies the test methods and requirements.

Bureau Veritas Consumer Products Services (Shanghai) No. 168, Guanghua Road, Zhuanciao Town, Minhang, Shanghai, China. Post Code:201108 Tel: 86-21-24166888 Fax: 86-21-64891984 Http : www.cps.bureauveritas.com

This report is governed by, and incorporates by reference, CPS Conditions of Service as posted at the date of issuance of this report at http://www.bureauveritas.com/home/about-us/our-business/cps/about-us/terms-conditions/and is intended for your exclusive use. Any copying or replication of this report to or for any other person or entity, or use of our name or trademark, is permitted only with our prior written permission. This report sets forth our findings solely with respect to the test samples identified herein. The results set forth in this report are not indicative or representative of the quality or characteristics of the lot from which a test sample was taken or any similar or identical product unless specifically and expressly noted. Our report includes all of the tests requested by you and the results thereof based upon the information that you provided to us. Measurement uncertainty is only provided upon request for accredited tests. You have 60 days from date of issuance of this report to notify us of any material error or omission caused by our negligence or if you require measurement uncertainty; provided, however, that such notice shall be in writing and shall specifically address the issue you wish to raise. A failure to raise such issue within the prescribed time shall constitute you unqualified acceptance of the completeness of this report, the tests conducted and the correctness of the report contents.

> The content of this PDF file is in accordance with the original issued reports for reference only. This Test Report cannot be reproduced, except in full, without prior written permission of the company.



BVCPS (SHANGHAI) GENERAL CONTACT INFORMATION FOR THIS REPORT

TELEPHONE NO E-MAIL: 86-21-24166888 bvcpshltoy.sh@cn.bureauveritas.com

BUREAU VERITAS CONSUMER PRODUCTS SERVICE DIVISION (SHANGHAI) Laboratory Test location: No. 368, Guangzhong Road, Zhuanqiao Town, Minhang, Shanghai. No. 168, Guanghua Road, Zhuanqiao Town, Minhang, Shanghai.

Abrens

Hyde Bao PRODUCT LINE MANAGER(HARDLINE DIVISON)



SUMMARY OF EXAMINATION

Introduction:

An examination was requested to ascertain compliance with the requirement(s) as detailed on page one of this report. The following clauses were considered applicable and our findings were as follows:

4 & EN 1728:2012+AC:2013,4.1Preliminary preparationCONDUCTEDSee note IDefect observed before testingSee note IIEN 581-1:2017General safety requirementsPASSSee note IIIEN 581-2:2015+AC:2016 A.1.1Sideway stability testPASSEN 1022:2005,6.6Rearward stability testPASSEN 1022:2005,7.5Rearward stability testPASSEN 581-2:2015+AC:2016 A.1.2Forward stability testPASSEN 1728:2012+AC:2013,8.2Seat & back static loadPASSEN 1728:2012+AC:2013,8.3Additional seat and leg rest static load testPASSEN 1728:2012+AC:2013,8.4.1Seat and back fatigue testPASSEN 1728:2012+AC:2013,8.4.2Additional seat durability testPASSEN 1728:2012+AC:2013,8.4.3Durability testPASSEN 1728:2012+AC:2013,8.4.4Additional seat durability testPASSEN 1728:2012+AC:2013,8.5Durability testPASSEN 1728:2012+AC:2013,8.6Arm downwards static load testNASee note IVEN 1728:2012+AC:2013,8.7Arm fatigue testNASee note IVEN 1728:2012+AC:2013,8.8Impact testPASSEN 1728:2012+AC:2013,8.8Impact testPASSEN 1728:2012+AC:2013,8.8Impact testPASSEN 1728:2012+AC:2013,8.9Lifting testNASee note IVEN 1728:2012+AC:2013,8.9Lifting testP	EN 581-2: 2015+AC:2016 (Tes	t Level: domestic level)		
1728:2012+AC:2013,4.1CONDUCTEDSee note 1Defect observed before testingSee note IIEN 581-1:2017General safety requirementsPASSSee note IIIEN 581-2:2015+AC:2016 A.1.1Sideway stability testPASSEN 1022:2005,6.6Rearward stability testPASSEN 1022:2005,7.5Rearward stability testPASSEN 1022:2015+AC:2016 A.1.2Forward stability testPASSEN 1728:2012+AC:2013,8.2Seat & back static loadPASSEN 1728:2012+AC:2013,8.4.1Seat and back fatigue testPASSEN 1728:2012+AC:2013,8.4.1Seat and back fatigue testPASSEN 1728:2012+AC:2013,8.4.2Additional seat durability testPASSEN 1728:2012+AC:2013,8.5Durability test on back rest mechanismNASee note IVEN 1728:2012+AC:2013,8.6Arm downwards static load testNASee note IVEN 1728:2012+AC:2013,8.7Arm fatigue testNASee note IVEN 1728:2012+AC:2013,8.8Impact testNASee note IVEN 1728:2012+AC:2013,8.9Lifting testNASee note IVEN 1728:2012+AC:2013,8.9Lifting testPASSEN 1728:2012+AC:2013,8.6Remark stability testPASSEN 1728:2012+AC:2013,8.7Arm downwards static load testNASee note IVEN 1728:2012+AC:2013,8.8Impact testPASSEN 1728:2012+AC:2016,6.6Rearward stability testPASS<	Clause	Description	Result	*Comments
EN 581-1:2017General safety requirementsPASSSee note IIIEN 581-2:2015+AC:2016 A.1.1Sideway stability testPASSEN 1022:2005,6.6Rearward stability testPASSEN 1022:2005,7.5Rearward stability testPASSEN 1022:2015+AC:2016 A.1.2Forward stability testPASSEN 581-2:2015+AC:2016 A.1.2Forward stability testPASSEN 1728:2012+AC:2013,8.2Seat & back static loadPASSEN 1728:2012+AC:2013,8.3Additional seat and leg rest static load testPASSEN 1728:2012+AC:2013,8.4.1Seat and back fatigue testPASSEN 1728:2012+AC:2013,8.4.2Additional seat durability testPASSEN 1728:2012+AC:2013,8.4.3Durability test on back rest mechanismNASee note IVEN 1728:2012+AC:2013,8.6Arm downwards static load testNASee note IVEN 1728:2012+AC:2013,8.7Arm fatigue testNASee note IVEN 1728:2012+AC:2013,8.8Impact testPASSEN 1728:2012+AC:2013,8.9Lifting testNASee note IVEN 1728:2012+AC:2013,8.9Lifting testPASSEN 1728:2012+AC:2016 A.1.1Sideway stability testPASSEN 1022:2005,6.6Rearward stability testPASSEN 1022:2005,7.5Rearward stability testPASSEN 581-2:2015+AC:2016 A.1.2Forward stability testPASSEN 581-2:2015+AC:2016 A.1.2 <td< td=""><td>4 & EN 1728:2012+AC:2013,4.1</td><td>Preliminary preparation</td><td>CONDUCTED</td><td>See note I</td></td<>	4 & EN 1728:2012+AC:2013,4.1	Preliminary preparation	CONDUCTED	See note I
EN 581-2:2015+AC:2016 A.1.1Sideway stability testPASSEN 1022:2005,6.6Rearward stability testPASSEN 1022:2005,7.5Rearward stability testPASSEN 1022:2015+AC:2016 A.1.2Forward stability testPASSEN 1728:2012+AC:2013,8.2Seat & back static loadPASSEN 1728:2012+AC:2013,8.3Additional seat and leg rest static load testPASSEN 1728:2012+AC:2013,8.4.1Seat and back fatigue testPASSEN 1728:2012+AC:2013,8.4.2Additional seat durability testPASSEN 1728:2012+AC:2013,8.4.2Additional seat durability testPASSEN 1728:2012+AC:2013,8.4.2Additional seat durability testPASSEN 1728:2012+AC:2013,8.4.2Additional seat durability testNASee note IVEN 1728:2012+AC:2013,8.5Durability test on back rest mechanismNASee note IVEN 1728:2012+AC:2013,8.6Arm downwards static load testNASee note IVEN 1728:2012+AC:2013,8.7Arm fatigue testNASee note IVEN 1728:2012+AC:2013,8.8Impact testPASSEN 1728:2012+AC:2013,8.9Lifting testNASee note IVEN 1728:2012+AC:2016 A.1.1Sideway stability testPASSEN 1022:2005,6.6Rearward stability testPASSEN 1022:2005,7.5Rearward stability testPASSEN 581-2:2015+AC:2016 A.1.2Forward stability testPASS<		Defect observed before testing		See note II
EN 1022:2005,6.6Rearward stability testPASSEN 1022:2005,7.5Rearward stability testPASSEN 1022:2015+AC:2016 A.1.2Forward stability testPASSEN 1728:2012+AC:2013,8.2Seat & back static loadPASSEN 1728:2012+AC:2013,8.3Additional seat and leg rest static load testPASSEN 1728:2012+AC:2013,8.4.1Seat and back fatigue testPASSEN 1728:2012+AC:2013,8.4.2Additional seat durability testPASSEN 1728:2012+AC:2013,8.4.2Additional seat durability testPASSEN 1728:2012+AC:2013,8.4.2Durability test on back rest mechanismNASee note IVEN 1728:2012+AC:2013,8.5Durability test on back rest mechanismNASee note IVEN 1728:2012+AC:2013,8.6Arm downwards static load testNASee note IVEN 1728:2012+AC:2013,8.7Arm fatigue testNASee note IVEN 1728:2012+AC:2013,8.8Impact testPASSEN 1728:2012+AC:2013,8.9Lifting testNASee note IVEN 1728:2012+AC:2016 A.1.1Sideway stability testPASSEN 1022:2005,6.6Rearward stability testPASSEN 1022:2005,7.5Rearward stability testPASSEN 581-2:2015+AC:2016 A.1.2Forward stability testPASSEN 581-2:2015+AC:2016 A.1.2Forward stability testPASSEN 581-2:2015+AC:2016 A.1.2Forward stability testPASS<	EN 581-1:2017	General safety requirements	PASS	See note III
EN 1022:2005,7.5Rearward stability testPASSEN 581-2:2015+AC:2016 A.1.2Forward stability testPASSEN 1728:2012+AC:2013,8.2Seat & back static loadPASSEN 1728:2012+AC:2013,8.3Additional seat and leg rest static load testPASSEN 1728:2012+AC:2013,8.4.1Seat and back fatigue testPASSEN 1728:2012+AC:2013,8.4.2Additional seat durability testPASSEN 1728:2012+AC:2013,8.4.2Additional seat durability testPASSEN 1728:2012+AC:2013,8.4.2Durability test on back rest mechanismNASee note IVEN 1728:2012+AC:2013,8.6Arm downwards static load testNASee note IVEN 1728:2012+AC:2013,8.7Arm fatigue testNASee note IVEN 1728:2012+AC:2013,8.8Impact testPASSEN 1728:2012+AC:2013,8.9Lifting testNASee note IVEN 1728:2012+AC:2013,8.9Lifting testPASSEN 1728:2012+AC:2016 A.1.1Sideway stability testPASSEN 1022:2005,6.6Rearward stability testPASSEN 1022:2005,7.5Rearward stability testPASSEN 581-2:2015+AC:2016 A.1.2Forward stability testPASSEN 581-2:2015+AC:2016 A.1.2Forward stability testPASSEN 581-2:2015+AC:2016 A.1.2Forward stability testPASSEN 581-2:2015+AC:2016 A.1.2Forward stability testPASS	EN 581-2:2015+AC:2016 A.1.1	Sideway stability test	PASS	
EN 581-2:2015+AC:2016 A.1.2Forward stability testPASSEN 1728:2012+AC:2013,8.2Seat & back static loadPASSEN 1728:2012+AC:2013,8.3Additional seat and leg rest static load testPASSEN 1728:2012+AC:2013,8.4.1Seat and back fatigue testPASSEN 1728:2012+AC:2013,8.4.1Seat and back fatigue testPASSEN 1728:2012+AC:2013,8.4.2Additional seat durability testPASSEN 1728:2012+AC:2013,8.5Durability test on back rest mechanismNASee note IVEN 1728:2012+AC:2013,8.6Arm downwards static load testNASee note IVEN 1728:2012+AC:2013,8.7Arm fatigue testNASee note IVEN 1728:2012+AC:2013,8.8Impact testNASee note IVEN 1728:2012+AC:2013,8.9Lifting testNASee note IVEN 1728:2012+AC:2016 A.1.1Sideway stability testPASSEN 1022:2005,6.6Rearward stability testPASSEN 1022:2005,7.5Rearward stability testPASSEN 581-2:2015+AC:2016 A.1.2Forward stability testPASS	EN 1022:2005,6.6	Rearward stability test	PASS	
EN 1728:2012+AC:2013,8.2Seat & back static loadPASSEN 1728:2012+AC:2013,8.3Additional seat and leg rest static load testPASSEN 1728:2012+AC:2013,8.4.1Seat and back fatigue testPASSEN 1728:2012+AC:2013,8.4.2Additional seat durability testPASSEN 1728:2012+AC:2013,8.4.2Additional seat durability testPASSEN 1728:2012+AC:2013,8.4.2Additional seat durability testPASSEN 1728:2012+AC:2013,8.5Durability test on back rest mechanismNASee note IVEN 1728:2012+AC:2013,8.6Arm downwards static load testNASee note IVEN 1728:2012+AC:2013,8.7Arm fatigue testNASee note IVEN 1728:2012+AC:2013,8.8Impact testPASSEN 1728:2012+AC:2013,8.9Lifting testNASee note IVEN 1728:2012+AC:2016 A.1.1Sideway stability testPASSEN 1022:2005,7.5Rearward stability testPASSEN 581-2:2015+AC:2016 A.1.2Forward stability testPASSEN 581-2:2015+AC:2016 A.1.2Forward stability testPASS	EN 1022:2005,7.5	Rearward stability test	PASS	
EN 1728:2012+AC:2013,8.3Additional seat and leg rest static load testPASSEN 1728:2012+AC:2013,8.4.1Seat and back fatigue testPASSEN 1728:2012+AC:2013,8.4.2Additional seat durability testPASSEN 1728:2012+AC:2013,8.4.2Additional seat durability testPASSEN 1728:2012+AC:2013,8.5Durability test on back rest mechanismNASee note IVEN 1728:2012+AC:2013,8.6Arm downwards static load testNASee note IVEN 1728:2012+AC:2013,8.7Arm fatigue testNASee note IVEN 1728:2012+AC:2013,8.8Impact testPASSEN 1728:2012+AC:2013,8.9Lifting testNASee note IVEN 1728:2012+AC:2013,8.9Lifting testNASee note IVEN 1728:2012+AC:2016 A.1.1Sideway stability testPASSEN 1022:2005,7.5Rearward stability testPASSEN 581-2:2015+AC:2016 A.1.2Forward stability testPASSEN 581-2:2015+AC:2016 A.1.2Forward stability testPASS	EN 581-2:2015+AC:2016 A.1.2	Forward stability test	PASS	
Ioad testPASSEN 1728:2012+AC:2013,8.4.1Seat and back fatigue testPASSEN 1728:2012+AC:2013,8.4.2Additional seat durability testPASSEN 1728:2012+AC:2013,8.4.2Additional seat durability testPASSEN 1728:2012+AC:2013,8.5Durability test on back rest mechanismNASee note IVEN 1728:2012+AC:2013,8.6Arm downwards static load testNASee note IVEN 1728:2012+AC:2013,8.7Arm fatigue testNASee note IVEN 1728:2012+AC:2013,8.8Impact testPASSEN 1728:2012+AC:2013,8.9Lifting testNASee note IVEN 1728:2012+AC:2016 A.1.1Sideway stability testPASSEN 1022:2005,7.5Rearward stability testPASSEN 581-2:2015+AC:2016 A.1.2Forward stability testPASSEN 581-2:2015+AC:2016 A.1.2Forward stability testPASS	EN 1728:2012+AC:2013,8.2	Seat & back static load	PASS	
EN 1728:2012+AC:2013,8.4.2Additional seat durability testPASSEN 1728:2012+AC:2013,8.5Durability test on back rest mechanismNASee note IVEN 1728:2012+AC:2013,8.6Arm downwards static load testNASee note IVEN 1728:2012+AC:2013,8.7Arm fatigue testNASee note IVEN 1728:2012+AC:2013,8.7Arm fatigue testNASee note IVEN 1728:2012+AC:2013,8.8Impact testPASSEN 1728:2012+AC:2013,8.9Lifting testNASee note IVEN 1728:2012+AC:2016 A.1.1Sideway stability testPASSEN 1022:2005,6.6Rearward stability testPASSEN 1022:2005,7.5Rearward stability testPASSEN 581-2:2015+AC:2016 A.1.2Forward stability testPASS	EN 1728:2012+AC:2013,8.3	•	PASS	
EN 1728:2012+AC:2013,8.5Durability test on back rest mechanismNASee note IVEN 1728:2012+AC:2013,8.6Arm downwards static load testNASee note IVEN 1728:2012+AC:2013,8.7Arm fatigue testNASee note IVEN 1728:2012+AC:2013,8.7Arm fatigue testNASee note IVEN 1728:2012+AC:2013,8.7Impact testPASSEN 1728:2012+AC:2013,8.8Impact testNASee note IVEN 1728:2012+AC:2013,8.9Lifting testNASee note IVEN 581-2:2015+AC:2016 A.1.1Sideway stability testPASSEN 1022:2005,6.6Rearward stability testPASSEN 581-2:2015+AC:2016 A.1.2Forward stability testPASSEN 581-2:2015+AC:2016 A.1.2Forward stability testPASS	EN 1728:2012+AC:2013,8.4.1	Seat and back fatigue test	PASS	
mechanismNASee note IVEN 1728:2012+AC:2013,8.6Arm downwards static load testNASee note IVEN 1728:2012+AC:2013,8.7Arm fatigue testNASee note IVEN 1728:2012+AC:2013,8.8Impact testPASSEN 1728:2012+AC:2013,8.9Lifting testNASee note IVEN 581-2:2015+AC:2016 A.1.1Sideway stability testPASSEN 1022:2005,6.6Rearward stability testPASSEN 1022:2005,7.5Rearward stability testPASSEN 581-2:2015+AC:2016 A.1.2Forward stability testPASS	EN 1728:2012+AC:2013,8.4.2	Additional seat durability test	PASS	
EN 1728:2012+AC:2013,8.7Arm fatigue testNASee note IVEN 1728:2012+AC:2013,8.8Impact testPASSEN 1728:2012+AC:2013,8.9Lifting testNASee note IVEN 581-2:2015+AC:2016 A.1.1Sideway stability testPASSEN 1022:2005,6.6Rearward stability testPASSEN 1022:2005,7.5Rearward stability testPASSEN 581-2:2015+AC:2016 A.1.2Forward stability testPASS	EN 1728:2012+AC:2013,8.5		NA	See note IV
EN 1728:2012+AC:2013,8.8Impact testPASSEN 1728:2012+AC:2013,8.9Lifting testNASee note IVEN 581-2:2015+AC:2016 A.1.1Sideway stability testPASSEN 1022:2005,6.6Rearward stability testPASSEN 1022:2005,7.5Rearward stability testPASSEN 581-2:2015+AC:2016 A.1.2Forward stability testPASS	EN 1728:2012+AC:2013,8.6	Arm downwards static load test	NA	See note IV
EN 1728:2012+AC:2013,8.9Lifting testNASee note IVEN 581-2:2015+AC:2016 A.1.1Sideway stability testPASSEN 1022:2005,6.6Rearward stability testPASSEN 1022:2005,7.5Rearward stability testPASSEN 581-2:2015+AC:2016 A.1.2Forward stability testPASS	EN 1728:2012+AC:2013,8.7	Arm fatigue test	NA	See note IV
EN 581-2:2015+AC:2016 A.1.1Sideway stability testPASSEN 1022:2005,6.6Rearward stability testPASSEN 1022:2005,7.5Rearward stability testPASSEN 581-2:2015+AC:2016 A.1.2Forward stability testPASS	EN 1728:2012+AC:2013,8.8	Impact test	PASS	
EN 1022:2005,6.6Rearward stability testPASSEN 1022:2005,7.5Rearward stability testPASSEN 581-2:2015+AC:2016 A.1.2Forward stability testPASS	EN 1728:2012+AC:2013,8.9	Lifting test	NA	See note IV
EN 1022:2005,7.5Rearward stability testPASSEN 581-2:2015+AC:2016 A.1.2Forward stability testPASS	EN 581-2:2015+AC:2016 A.1.1	Sideway stability test	PASS	
EN 581-2:2015+AC:2016 A.1.2 Forward stability test PASS	EN 1022:2005,6.6	Rearward stability test	PASS	
	EN 1022:2005,7.5	Rearward stability test	PASS	
8.1 Instruction for use PASS	EN 581-2:2015+AC:2016 A.1.2	Forward stability test	PASS	
	8.1	Instruction for use	PASS	



ANNEX I: SUBMISSION DESCRIPTION

Sample Description: STEEL TEXILENE LOUNGER

The overall dimension was recorded as: $(200.0-164.3) \text{ cm} (D) \times 61.0 \text{ cm} (W) \times (32.7-92.0) \text{ cm} (H)$

Sample weight: 12.1kg

ANNEX II: ADDITIONAL COMMENTS

- Samples were stored in indoor ambient condition 24 hours immediately prior to testing.
- II No defect was observed before testing.
- III Reference to detail test results of EN 581-1: 2017

EN 581-1: 2017			
Clause	Description	Result	*Comments
5.1	General	PASS	
5.2	Tubular components	PASS	
5.3	Shear and squeeze points		
5.3.1	Shear and squeeze points when erecting, adjusting and folding away	PASS	
5.3.2	Shear and squeeze points under the influence of powered mechanisms	NA	See note IV
5.3.3	Shear and squeeze points during use	PASS	

IV NA = Not applicable

V NC = Not conducted as per client request



Plicosa International Taiwan Ltd Technical Report: (6619)305-0589 NOV.15, 2019 Page 5 of 10




EXHIBIT



Plicosa International Taiwan Ltd Technical Report: (6619)305-0589 NOV.15, 2019 Page 6 of 10

INSTRUCTION

IMPORTANT, RETAIN FOR FUTURE REFERENCE: READ CAREFULLY



Only for domestic use.

Maintenance

- Clean with a soft cloth.
- Remove dust regularly with the help of a soft and clear water.
- Do not use abrasive cleaners or detergents for cleaning.

Storage conditions


- After each use, keep the product dry and protected from the elements.
- Do not keep wet.
- This lounger must be stored in a dry place.

SUPPLIER PLICOSA INTERNATIONAL TAIWAN LTD 3/F, N°39 Lane 513, Ruiguang Road, Neihu, Taipei, TAIWAN ROC



Plicosa International Taiwan Ltd Technical Report: (6619)305-0589 NOV.15, 2019 Page 7 of 10

IMPORTANTE – CONSERVE ESTA INFORMACIÓN PARA SU CONSULTA POSTERIOR : LEER DETALLADAMENTE



Solamente para Uso Doméstico.

Mantenimiento

- · Limpiar con la ayuda de un trapo suavemente.
- · Retirar el polvo regularmente con la ayuda de un paso suave y de agua clara.
- · No utilizar detergentes o productos abrasivos para su limpieza.

Condiciones de almacenaje

- · Después de cada utilización guarde el producto seco y en al resguardo de la intemperie.
- No guardar nunca húmedo.
- · Esta tumbona debe almacenarse en un lugar seco.

PROVEEDOR PLICOSA INTERNATIONAL TAIWAN LTD 3/F, N°39 Lane 513, Ruiguang Road, Neihu, Taipei, TAIWAN ROC



Plicosa International Taiwan Ltd Technical Report: (6619)305-0589 NOV.15, 2019 Page 8 of 10

IMPORTANTE – CONSERVE ESTA INFORMAÇÃO PARA UMA CONSULTA POSTERIOR : LER COM ATENÇÃO



Apenas para uso doméstico.

Manutenção

- Limpar com um pano humido suave.
- Retirar o pó regularmente com ajuda de um pano suave e de agua limpa.
- Não utilizar detergentes ou produtos abrasivos.

Condições de armazenamento

- Depois de cada utilização guardar e limpar ao abrigo das intemperies.
- Nunca guardar a mesa molhada.
- · Esta espreguiçadeira deve ser armazenada em local seco.

FORNECEDOR Plicosa International Taiwan Ltd 3F, No.39, Lane 513, Ruiguang Rd.,Neihu,Taipei,Taiwan, R.O.C.



Plicosa International Taiwan Ltd Technical Report: (6619)305-0589 NOV.15, 2019 Page 9 of 10

IMPORTANT - À CONSERVER POUR CONSULTATION ULTÉRIEURE : À LIRE ATTENTIVEMENT



Usage Domestique uniquement

Entretien

- Laver à l'eau et au savon.
- · Procéder au dépoussiérage régulier de l'article à l'aide d'un chiffon doux et de l'eau claire.
- Ne pas utiliser de détergents ou de produits abrasifs pour le nettoyage.

Conditions de stockage

· Après chaque utilisation rentrer votre produit au sec et à l'intérieur,

Ne pas ranger humide.

Cette bain de soleil doit être stockée dans un endroit sec.


Cette chaise longue doit être rangée dans un endroit sec

Furnisseur

Plicosa International Taiwan Ltd 3F, No.39, Lane 513, Ruiguang Rd., Neihu, Taipei, Taiwan, R.O.C.



Plicosa International Taiwan Ltd Technical Report: (6619)305-0589 NOV.15, 2019 Page 10 of 10

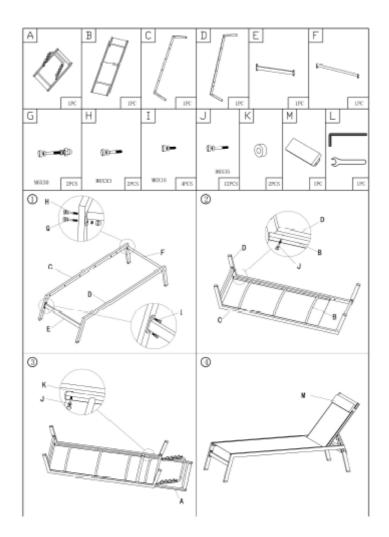

<u>END</u>